




Sceptre X9 Komodo VII Power Supply Unit Replacement

Removing power supply unit.

Written By: Jose Carrillo

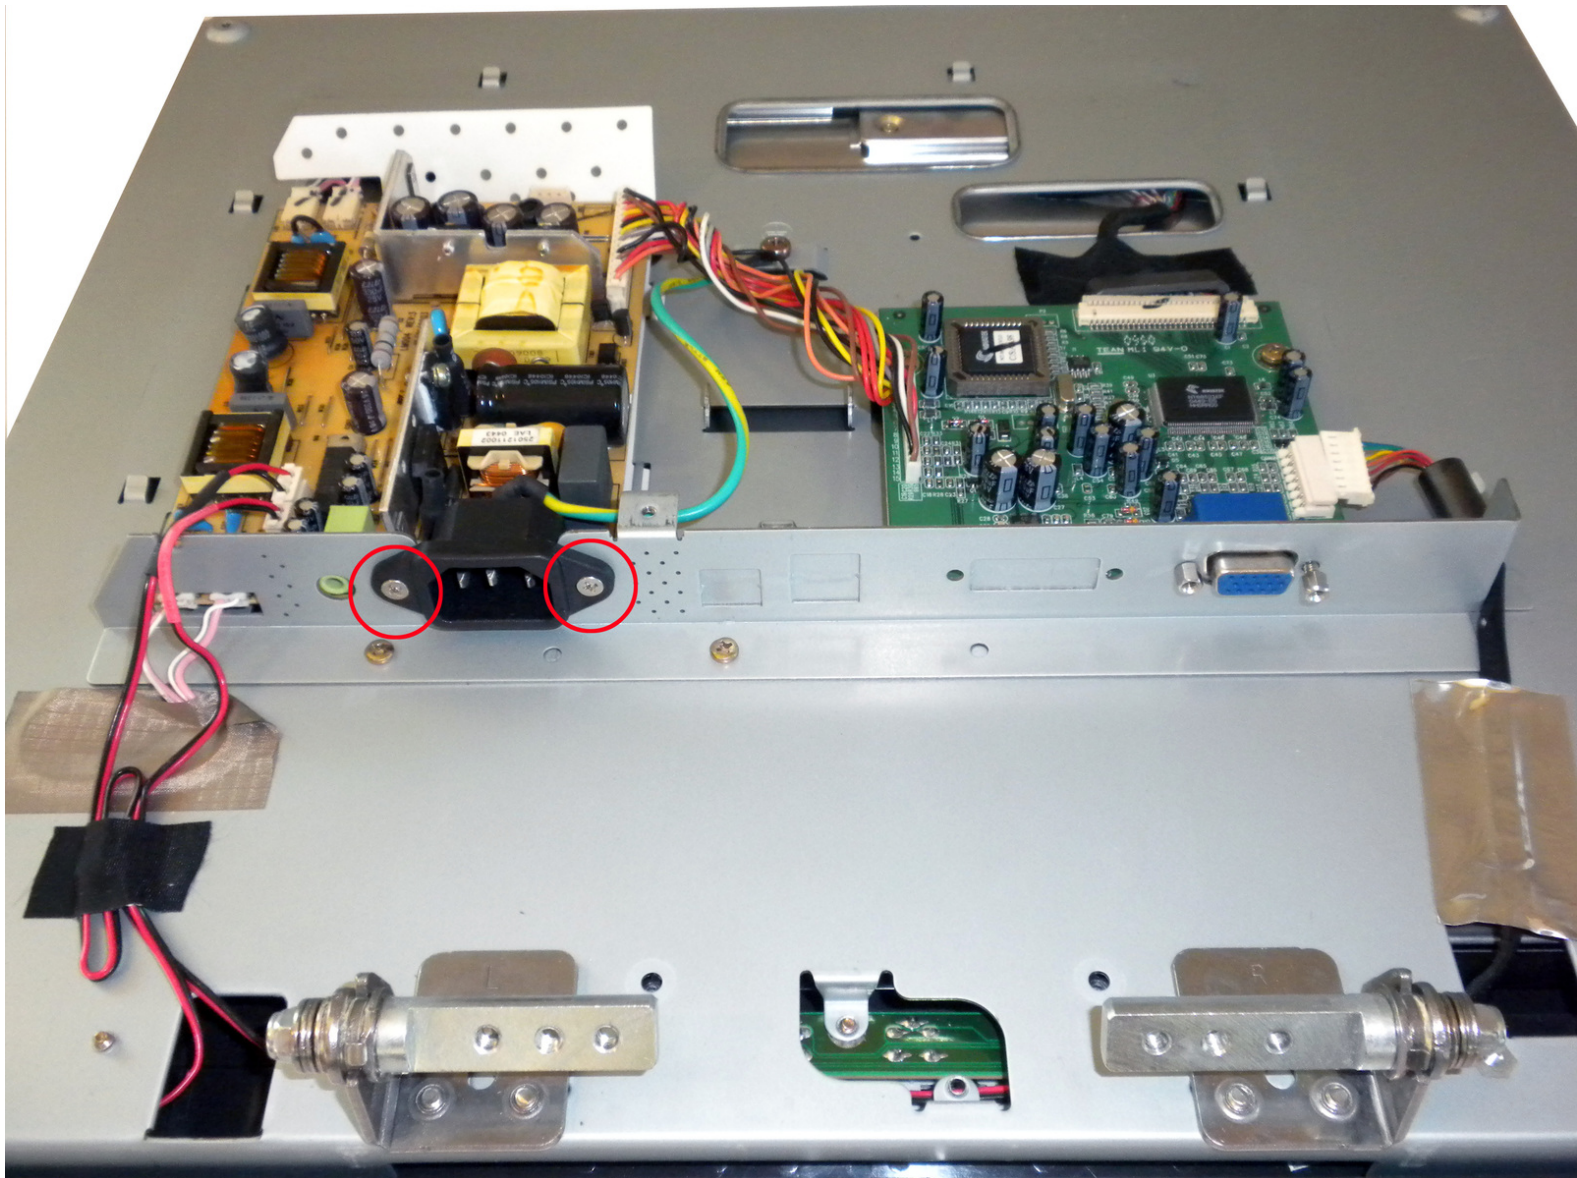

INTRODUCTION


Use this guide to remove the power supply unit.



TOOLS:

- [Phillips #2 Screwdriver](#) (1)
-

Step 1 — Stand

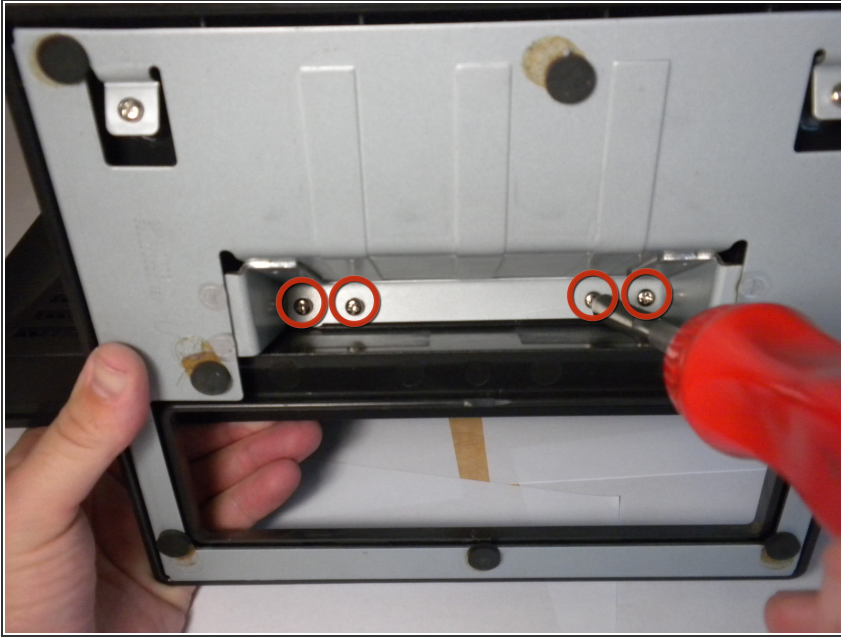

- Place the monitor face down.
- Remove the four 11.5mm screws with a #2 Phillips screwdriver.
- Remove the stand by pulling it out.

Step 2




- Remove two 11.5mm screws with a #2 Phillips screwdriver.
- Remove the plastic bar.

Step 3 — Board Cover





- Using a #2 Phillips screwdriver, remove the six 7mm screws at the circled locations.

Step 4

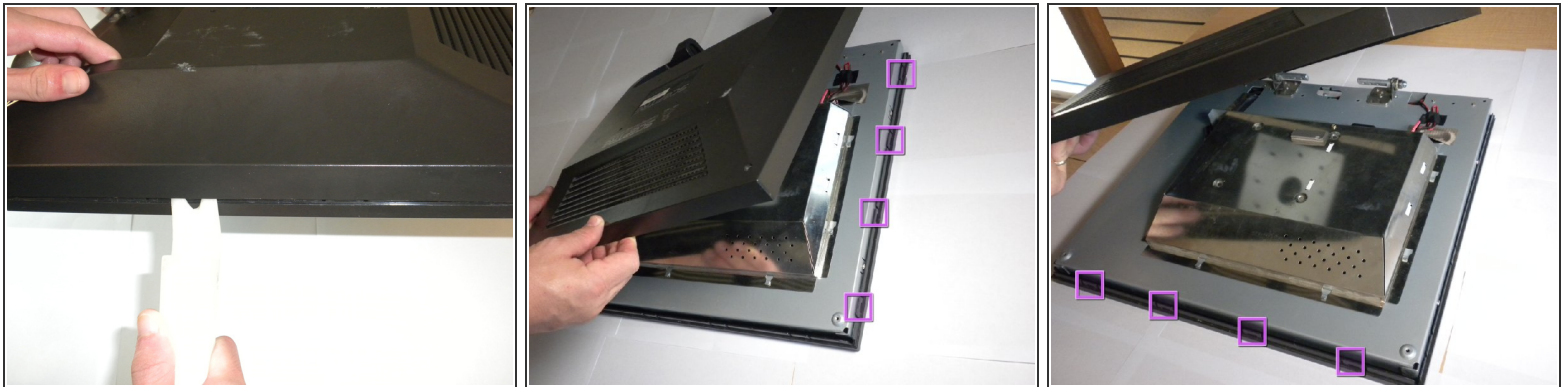


- Pry the monitor using the plastic opening tool to release the clips holding the cover on.
 - ❗ There are four clips on each side, four on the top, and one on the bottom.
 - ❗ You may hear a loud snapping noise when releasing the clips. Do not be alarmed, it is natural.
- Once all the clips have been released, remove the cover by pulling it up.

Step 5

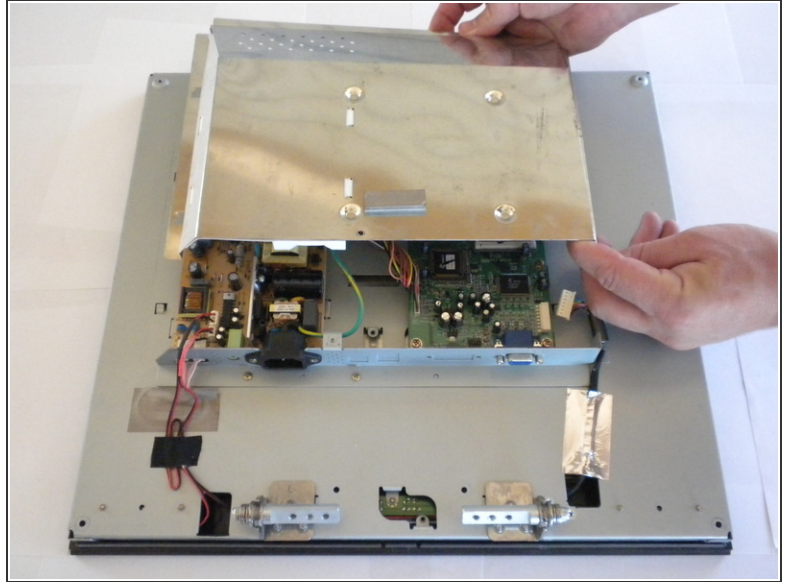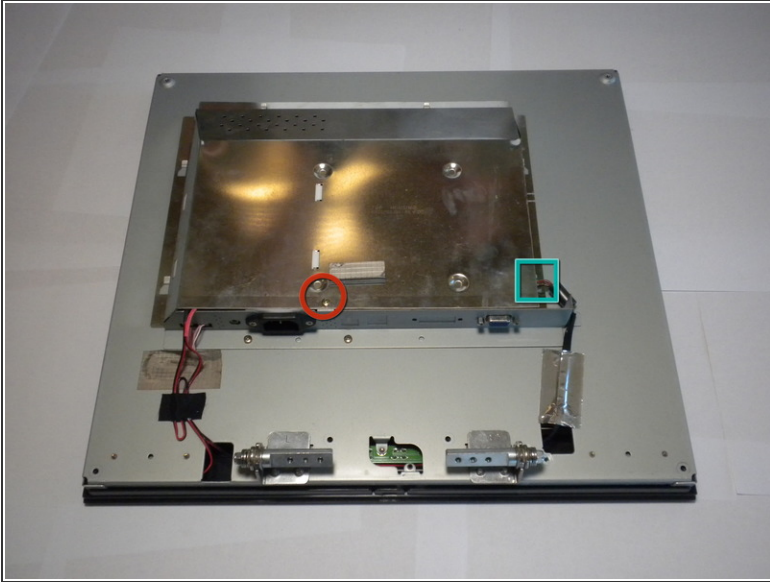


- Using the #2 Phillips screwdriver, remove the one 6mm screw.
- Unplug the indicated cable by pulling on the base.
- Slide the cover toward the top of the monitor.
- Remove the cover.

Step 6 — Power Supply Unit

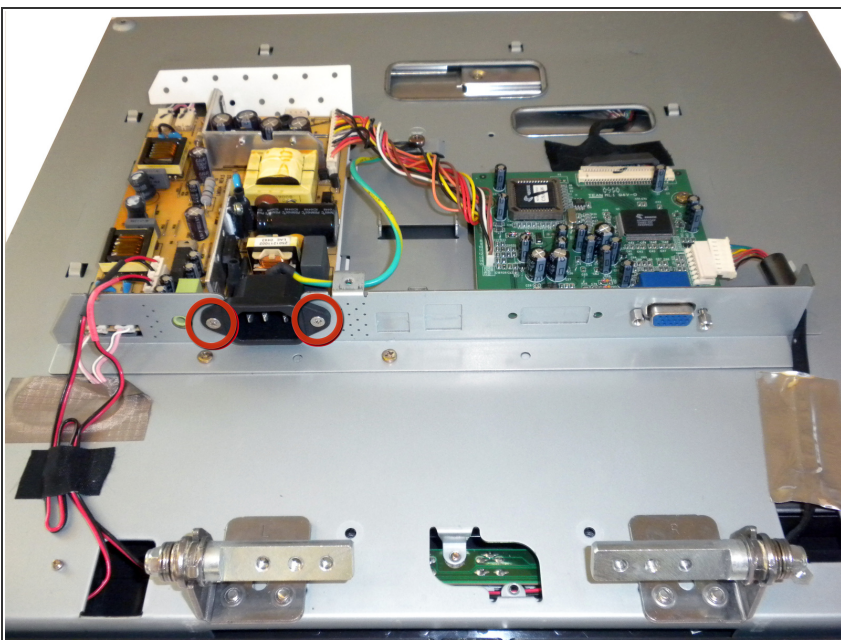


- Using a #2 Phillips screwdriver, remove the two 4.72 mm Phillips screws that hold the power adapter in place.

Step 7

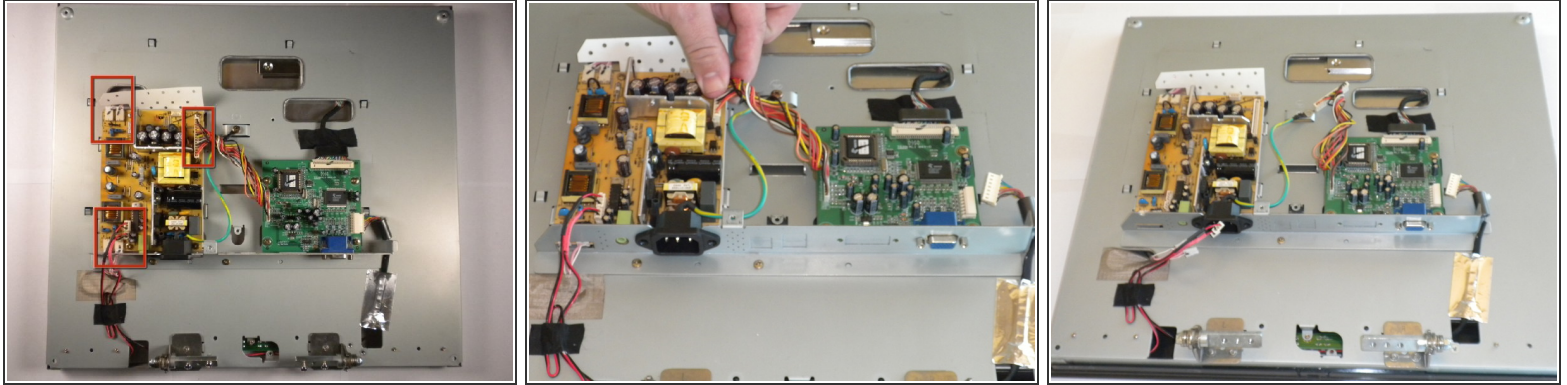



- Unplug the seven connections from the power supply unit by gently pulling on them.

Step 8

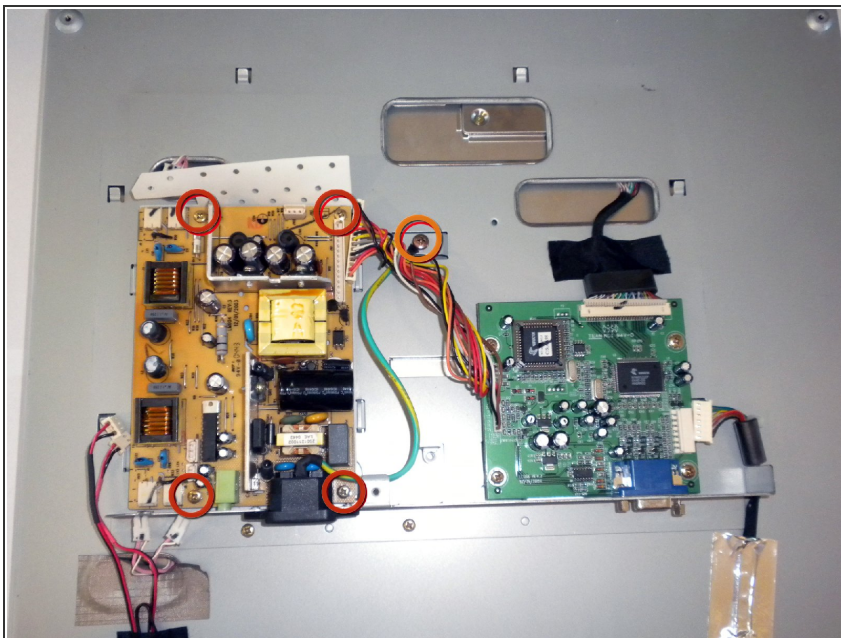

- Using a #2 Phillips screwdriver, remove the screws and the wire that is attached to the ground.
- Four 6 mm Phillips screws
- One 8 mm Phillips screw

Step 9

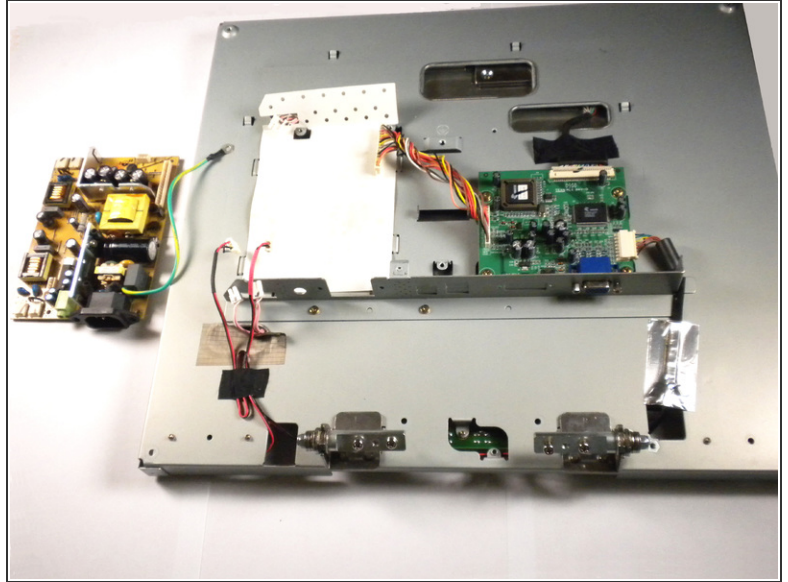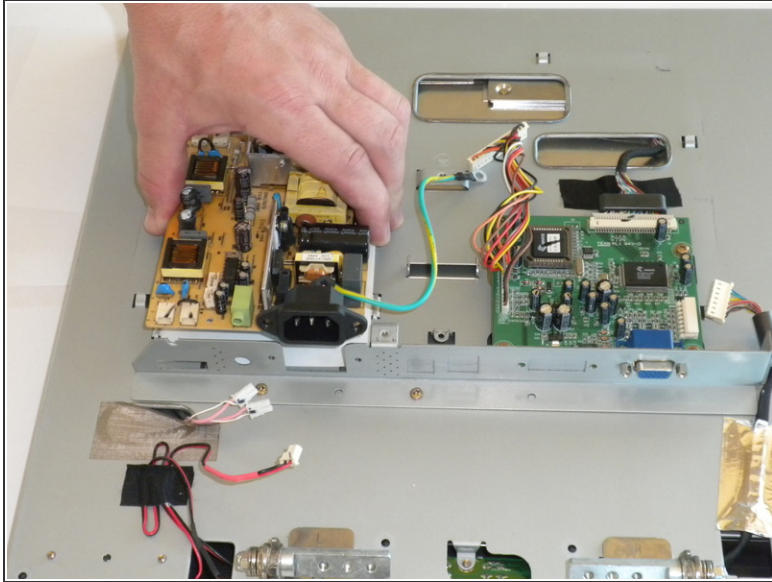

- Lift the power supply unit straight up to remove it from the back panel.

To reassemble your device, follow these instructions in reverse order.

This document was last generated on 2017-06-19 01:15:59 AM.